

City of Wichita, Kansas

Americans with Disabilities Act Transition Plan

Kansas Sports Hall of Fame

2nd and Mead

November 2005



Prepared by

DMCG

Disability Management Consulting Group L.L.C.

2801 Jonquil Place
Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita – ADA/504 Transition Plan – Kansas Sports HOF - November 2005 Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

| Locations | Structural Inconsistencies | | Recommended Corrections/Modifications to Ensure Program Access | Criteria – L=low, M=medium, H=high | | | Supplemental Technical Information | | | Finalized Actions | | |
|-----------------|---|--|---|---|---------------|-----------------|------------------------------------|------------------|---|----------------------|----------------------|-------------------------------------|
| Location | Identified Issue | ADAAG Specifications | Recommended Correction | Priority (overall) | Public Access | Frequency - PWD | Photo # | Conceptual Costs | Support Information | Finalized Correction | Date to be Corrected | Date Completed (Include initial) |
| 1. Restrooms | Braille signage exists at the entrance door to the men’s restroom, but the signage is in the wrong location. | 4.1.3(16) 4.30.4 | Signs that identify permanent rooms and spaces are required to be provided in Braille, mounted at 60-inches high measured to the center of the sign located at the latch side of the entrance door. In addition, the symbol of accessibility is required to exist at the entrance of accessible restrooms. Move the existing Braille signage to the latch side of the entrance door. | L | H | M | 2 | \$25 | Signage Specifications for Permanent Rooms and Spaces | | | |
| 2. Restrooms | In the men’s restroom, the trash container impedes the required clear floor space at the lavatory. | 4.19 | Accessible lavatories are required to have a clear floor space of 30-inches by 48-inches, where this space is centered and protrudes under lavatories 19-inches. Move the trash container. | L | H | M | 3 | \$0 | See Attachment 4 – Lavatory Specifications for more information | | | |
| 3. Restrooms | The seat cover dispensers, in the men’s and women’s restrooms, are not within appropriate reach range and do no have appropriate clear floor space. | 4.2.5 4.2.6 4.24 | At least one of each type of dispenser is required to be accessible and must be within a maximum reach range of 54-inches where a side reach is possible and a maximum of 48-inches where only a forward reach is possible, to the highest operable part. In addition, each accessible operating mechanism or device is required to have a 30-inch by 48-inch in front. Move the seat cover dispensers so they comply with ADAAG specifications. | M | H | M | 7 | \$200 | See Building Block #10 – Reach Ranges #1, #2, #3. | | | |
| 4. Restrooms | The entrance door to the Family restroom has a push/pull weight of more than 5-pounds. | 4.13 | According to ADAAG, interior doors are required to have a push/pull weight not exceeding 5lbs. Modify this door to comply with ADAAG specifications, by reducing hydraulic closer force. | M | H | M | N A | \$20 | See Building Block 8 – Accessible Doors | | | |
| 5. Donation Box | The donation box is located too high measuring 61-inches. | 4.2.5 4.2.6 | At least one of each type of device is required to be accessible and must be within a maximum reach range of 54-inches where a side reach is possible and a maximum of 48-inches where only a forward reach is possible. Lower the donation box so that the top is a maximum height of 54-inches. | M | H | M | 8 | \$100 | See Building Block #10 – Reach Ranges #1, #2, #3. | | | |

| Locations | Structural Inconsistencies | | Recommended Corrections/Modifications to Ensure Program Access | Criteria – L=low, M=medium, H=high | | | Supplemental Technical Information | | | Finalized Actions | | |
|-----------------|---|---|---|---|---------------|-----------------|------------------------------------|------------------|---|-------------------|----------------------|-------------------------------------|
| | | ADAAG Specifications | | Priority (overall) | Public Access | Frequency - PWD | Photo # | Conceptual Costs | | | | |
| Location | Identified Issue | | Recommended Correction | | | | | | Support Information | | Date to be Corrected | Date Completed (Include initial) |
| 6. Exit Signage | Exit signs throughout the facility are not provided in Braille. | 4.1.3(16) 4.30.4 | Signs that identify permanent rooms and spaces are required to be provided in Braille, mounted at 60-inches high measured to the center of the sign located at the latch side of doors. Where rooms and spaces are identified by number, including exit signs, ensure these spaces are also identified by Braille and comply with ADAAG permanent room signage specifications. | L | H | M | 1 2 1 3 | \$500 | Signage Specifications for Permanent Rooms and Spaces | | | |
| | | | | | | | | | | | | |

Kansas Sports Hall of Fame - Conceptual Cost Projections

| | |
|--------------|--------------|
| Total | \$845 |
|--------------|--------------|

| | |
|-----------------------------|--------------|
| Year One (Very High) | \$0 |
| Year Three (High) | \$0 |
| Year Five (Medium) | \$320 |

| | |
|-----------------------|--------------|
| Year Ten (Low) | \$525 |
|-----------------------|--------------|